

January 2, 2022

Unit	Affected Core/Notes	Solution/Replacement
FA150	GN-8093D/E/F/G/H Update transponder software to 4.07 to prevent	Software Update v4.07 or FA170
FELCOM 15/16	GN-8097B/C/D: 4850296*** F15 S/N 3533-9471 and after F16 S/N 3534-2756 and after Software update may resolve. Update varies according to existing software	Software Update or FELCOM 18/19
FELCOM 18/19	GN-8097B/C/D FELCOM18 4507-4045 and earlier FELCOM19 3599-2507 and earlier	V1.20 Software Required
GP-150/DUAL		Update software to v4.05
GP-80 GP-90/DUAL	GN-8096C: 4850264**** GN-097C/D: 4850296****	GP170 / GP170D
GP1650W/WD/WDF/WF GP1850W/WD/WDF/WF GP-7000F	GN-8091	GP1871F / GP1971F
GP500MK2		GP33 or GP39
GP3500 GP3500F	GN-8096	Update Software to v6.03
GP32/37	GN-8093: 4850264*** GP32 4439-1804 and above GP37 4441-3006 and above	GP33 or GP39
GP33	GN-8093D/E/F/G/H: 4850264*** Earlier S/N than 6412-8195	Software update v2.04 or higher
BBWGPS (GP320B) GP330B WS200	GH-8299 GP330B Earlier than 4457-7001	GP330B 220WX
SC30 GS100	GN-8093D/E/F/G/H: 4850263*** GN-8094D/E/F/G	Software update v3.03
SC50 SC110	GN-8094D/E/F/G	Update software of Processor to v2.02 to move rollover to 7/17/2039
FA50	GN-8093	Update software to v2.02 to move rollover to 07/16/2039